21604

ZONE REV.

\_

N/C NEW RELEASE

1


DATE

12/20/04/2 9/2

APPROVED

ח

This print and associated documents and the contained information are the confidential property of ELECTRONIC CABLE SPECIALISTS. Disclosure of, and/or reproduction of, all or part thereof or manufacture of any part from information contained on this print not specifically permitted by ELECTRONIC CABLE SPECIALISTS in writing is forbidden.

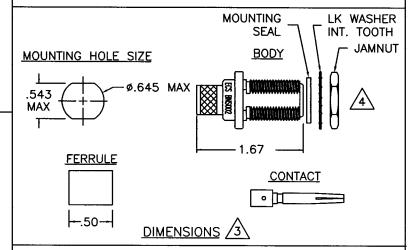

# **SPECIFICATIONS**

### ELECTRICAL

IMPEDANCE: 50 OHMS NOMINAL FREQUENCY RANGE: 0-11 GHz
VSWR: 1.2:1 MAXIMUM DC TO 2GHz
INSERTION LOSS: .1dB MAXIMUM DC TO 2GHz

WORKING VOLTAGE: 1000 VRMS @ SEA LEVEL
DIELECTRIC WITHSTANDING: 2500 VRMS @ SEA LEVEL
INSULATION RESISTANCE: 5000 MEGOHMS MINIMUM

#### MECHANICAL

CONNECTOR INTERFACE DIMENSION PER MIL-STD-348A

FIGURE 304-2 (N)

TERMINATION STYLE: INNER CONTACT—SOLDER OR CRIMP FERRULE—CRIMP

@ 500 VOLTS DC

CABLE RETENTION: 60 LBS

#### **ENVIRONMENTAL**

TEMPERATURE RATING: -65° TO +165° C
VIBRATION: MIL-STD-202, METHOD 204, COND. B
SHOCK: MIL-STD-202, METHOD 213, COND. I
THERMAL SHOCK: MIL-STD-202, METHOD 107, COND. B
CORROSION: MIL-STD-202, METHOD 101, COND. B
MOISTURE RESISTANCE: MIL-STD-202, METHOD 106

### **MATERIALS**

BODY: BRASS PER QQ-B-626

FERRULE: ANNEALED BRASS PER QQ-B-626

CENTER CONTACT: BERYLLIUM COPPER PER QQ-C-530


DIELECTRIC: TEFLON PER L-P-403 GASKET: SILICON RUBBER PER ZZ-R-765

FINISHES


BODY, FERRULE: BRIGHT NICKEL PER QQ-N-290 CENTER CONTACT: GOLD PER MIL-G-45204

## INSTALLATION INSTRUCTIONS


1. BEGIN BY CUTTING THE CABLE OFF SQUARE.



2. WHEN USING AUTOMATIC STRIPPING EQUIPMENT, STRIP CABLE AS SHOWN STARTING WITH L1 AND ENDING WITH L3. TAKE CARE NOT TO NICK THE CONDUCTORS WHILE STRIPPING THE DIELECTRIC AND JACKET. IF AUTOMATIC STRIPPING EQUIPMENT IS NOT AVAILABLE, STRIP ONLY L1 AND L3 AND TRIM EXCESS BRAID AT STEP 10.




3. SLIDE THE FERRULE AND ADHESIVE SHRINK TUBING 11 OVER THE END OF THE CABLE.




4. SOLDER THE CONTACT ONTO THE CENTER CONDUCTOR, PER MIL—STD—2000, USING 63Sn/37Pb SOLDER OR CRIMP WITH Y1757 DIE. ENSURE THE CONTACT IS BUTTED AGAINST THE CABLE DIELECTRIC. CLEAN ALL FLUX RESIDUES USING AN APPROPRIATE FLUX CLEANER.




5. USING TWEEZERS, FOLD THE OUTER BRAID BACK OVER THE CABLE JACKET, LEAVING AS MUCH WEAVE AS POSSIBLE.



6. SLICE THE ALUMINUM/POLYESTER FOIL LENGTHWISE ABOUT EVERY 1/8". GENTLY ROTATE PIN TO SEPARATE THE FLAT FOIL BRAID AND ALUMINUM/POLYESTER FOIL FROM THE DIELECTRIC. USING TWEEZERS, FOLD BACK ALUMINUM/POLYESTER FOIL OVER THE OUTER BRAID.




7. USING TWEEZERS, FOLD THE INNER BRAID BACK OVER
THE OTHER SHIELDS, LEAVING AS MUCH WEAVE AS POSSIBLE.
NOTE: DO NOT UNRAVEL DIELECTRIC WHEN PULLING
BACK INNER SHIELD.




8. SLIDE THE BODY OF THE CONNECTOR OVER THE END OF THE CABLE UNTIL THE NOTCH IN THE CONTACT SEATS WITH THE DIELECTRIC RIDGE INSIDE THE CONNECTOR BODY.

DESCRIPTION


REVISIONS



9. FOLD ALL THREE BRAIDS UP OVER THE NECK OF THE CONNECTOR BODY.



10. SLIDE THE FERRULE UP OVER THE SHIELDS AND AGAINST THE CONNECTOR BODY. TRIM AWAY ANY EXCESS BRAID. CRIMP THE FERRULE ONCE, NEXT TO THE BODY, USING THE M22520/5-31 DIE (A HEX) IN A M22520/5-01 TOOL FRAME. APPLY ADHESIVE HEAT SHRINK.




 $\stackrel{\textstyle 1}{\textstyle 1}$  ensure heat shrink is installed prior to crimping connector.

ADHESIVE HEAT SHRINK SHOULD BE APPLIED IN ACCORDANCE WITH ECS WORK INSTRUCTION WI007. CONTACT ECS FOR A COPY OF THIS WORK INSTRUCTION.

3 CONNECTOR DIMENSIONS ARE FOR REFERENCE ONLY.

4 INSTALL MOUNTING SEAL, LOCK WASHER AND JAMNUT IN ORDER SHOWN.

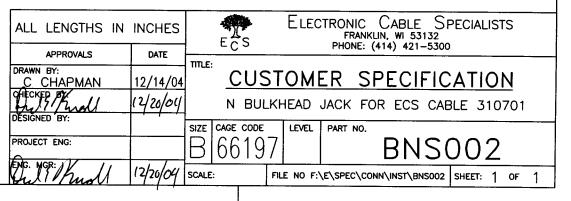

4

3

2

•