

CONSTANT CURRENT CW LASER DRIVER

Description

This laser driver is for driving diode lasers with high stability and high power efficiency. It provides these functions: laser constant current control, laser current monitoring, control loop stability indications, and shut down. It provides a high stability and low noise 2.5V reference voltage which can be used for setting the output current, or for ADCs & DACs.

Main features: high efficiency, low noise, high reliability, zero EMI and small package.

CWD-01-V2 Part number: Laser current control signal level: 0 to 2.5V Control accuracy: +0.2%Laser current indication signal level: 0 to 2.5V Indication accuracy: $\pm 0.2\%$ Maximum output current: 2A Current output noise: 0.05% Laser driver efficiency: ≥90%

Power input DC voltage: 3.0V to 5.5V

Output reference voltage: 2.5V

Operating temperature: -20°C to $+85^{\circ}\text{C}$

Pin Descriptions

- **Pin 1 SDNG**, shut down control, digital input. Negative logic, at the internal chip control input: >1.4V = enable, <0.95V = shut down, norminal threshold voltage = 1.2V. The input current is between 3μA and 8μA. There is a resistor, a Schottky diode, and a capacitor circuit in front of the internal input pin. See Figure 2. This circuit allows a slow start up and a quick shut down.
- **Pin 2 LDGD**, laser diode good, digital output. When this pin is high, >1V, the control loop is working properly. When this pin is low, <1V, the laser diode is bad, or there is a short or open circuit at the laser diode. This pin comes from an open drain output and is pulled up by a $100\text{K}\Omega$ resistor.
- Pin 3 GND, signal ground. Connect ADC and DAC grounds to here.
- **Pin 4** 2.5V, reference voltage, analog output. It can source 3mA max, with 5μVp-p noise @ 0.1 to 10 Hz and 25ppm/°C stability max.
- **Pin 5** LCS, laser current set-point voltage, analog input. There is an input resistor of 100K tied to GND. Setting it from 0V to 2.5V will set the laser current from 0A to 2A linearly.
- **Pin 6 LCO**, laser current output indication, analog output. 0V to 2.5V indicates the laser current of from 0A to 2A linearly.
- **Pin 7 GND**, the same as PIN 3.
- **Pin 8** LCGD, laser current good, control loop indication, analog output. When this pin is stabilized and the value is between 0.2V and 1.8V, the output voltage to the laser, Pin 9 LDA, will be 4.8V to 0V



linearly, the laser current is stabilized, and the control loop is stable. This pin has a similar function as Pin 2 LDGD, except that this pin is of an analog output and Pin 2 is of a digital output.

- Pin 9 LDA, laser diode anode, analog output. Connect it to the anode of the laser diode.
- **Pin 10 PGND**, power ground. Connect this pin directly to the cathode of the laser diode.
- **Pin 11 PGND**, power ground. Connect this pin directly to power supply return pass.
- **Pin 12 VPS**, power supply voltage, power input. The driver will work from VPS = 3.0V to 5.5V.

Figure 1 illustrates two typical connection schematics.

Figure 1

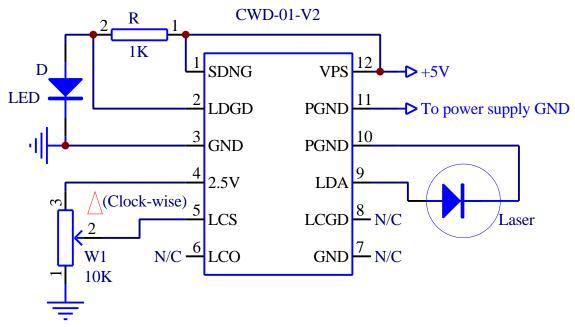


Figure 2A Self-contained

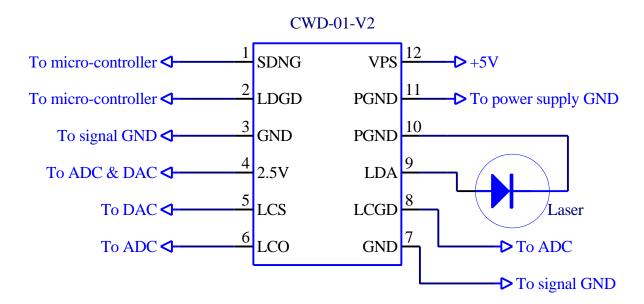
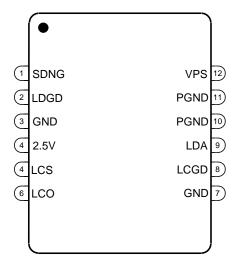


Figure 2B Micro-processor Based

Pin Configurations and Mechanical Dimensions





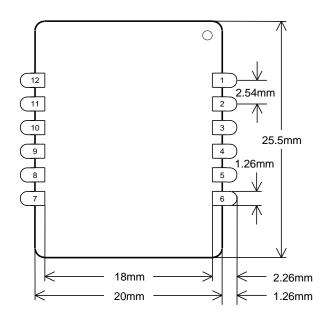


Figure 4 Bottom View of CWD-01-V2-S




Figure 5 Side View of CWD-01-V2-D




Figure 6 End View of CWD-01-V2-D



Figure 7 End View of CWD-01-V2-S

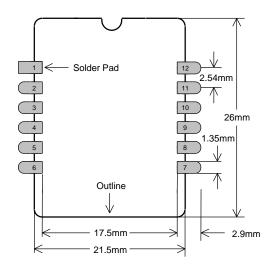


Figure 8 Recommended PCB footprint for surface mount package

Note: The Constant Current CW Laser Drivers come in two types of packages: surface mount and through hole. The surface mount package has to be soldered manually, not by reflow oven. The through hole package can be mounted in a socket, soldered manually, or by wave soldering machine. Package type is designated by suffixing D (through hole) or S (surface mount) to the part number.